

PRODUCT UPDATE (PU)

BULLETIN : PU-22-01 (REFERENCE: OTI-22-01)

SYSTEM : Frame Mechanical

AFFECTED TANKS : Cat® Articulated Truck-Spray King® manufacturing date prior to 10/26/2022 .

REASON : Under-torqued bolts and potential of missing/incorrect installed hardware on front mounts.

COMPLETION : Visual inspection – Maintenance Checkpoint.


PRODUCT UPDATE:

Installation of Cat® Hardware:

- Cap screw (bolt) 1D-4585 QTY required 8
- Nut 4K-0367 QTY required 8
- Washer 5P-8247 QTY required 16
- Torque stripe (thin lacquer)
- Replace rubber pad with ½" Fabri-Flex pad QTY required 2

REVISION CHANGE:

Bill Of Materials (BOM)-Use of Cat hardware and ½" Fabri-Flex

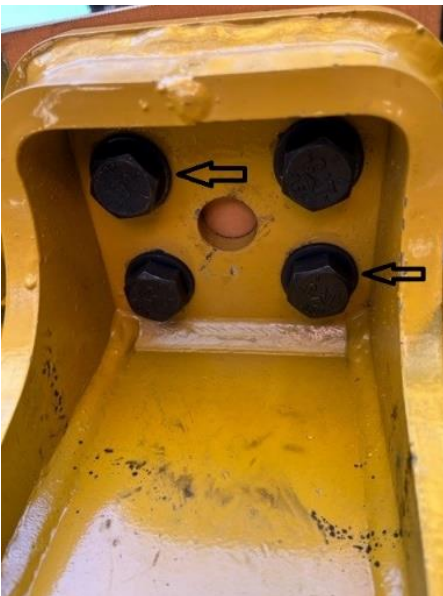

Pic4



Pic5

Call 844.465.8634

Email SprayKing@holtmfg.com

